

Battery power, AC to DC adapter power

Flexible 3000 Amp current probe

Model : CP-3001-Y


ISO-9001, CE, IEC1010



Lutron

LUTRON ELECTRONIC

The Art of Measurement

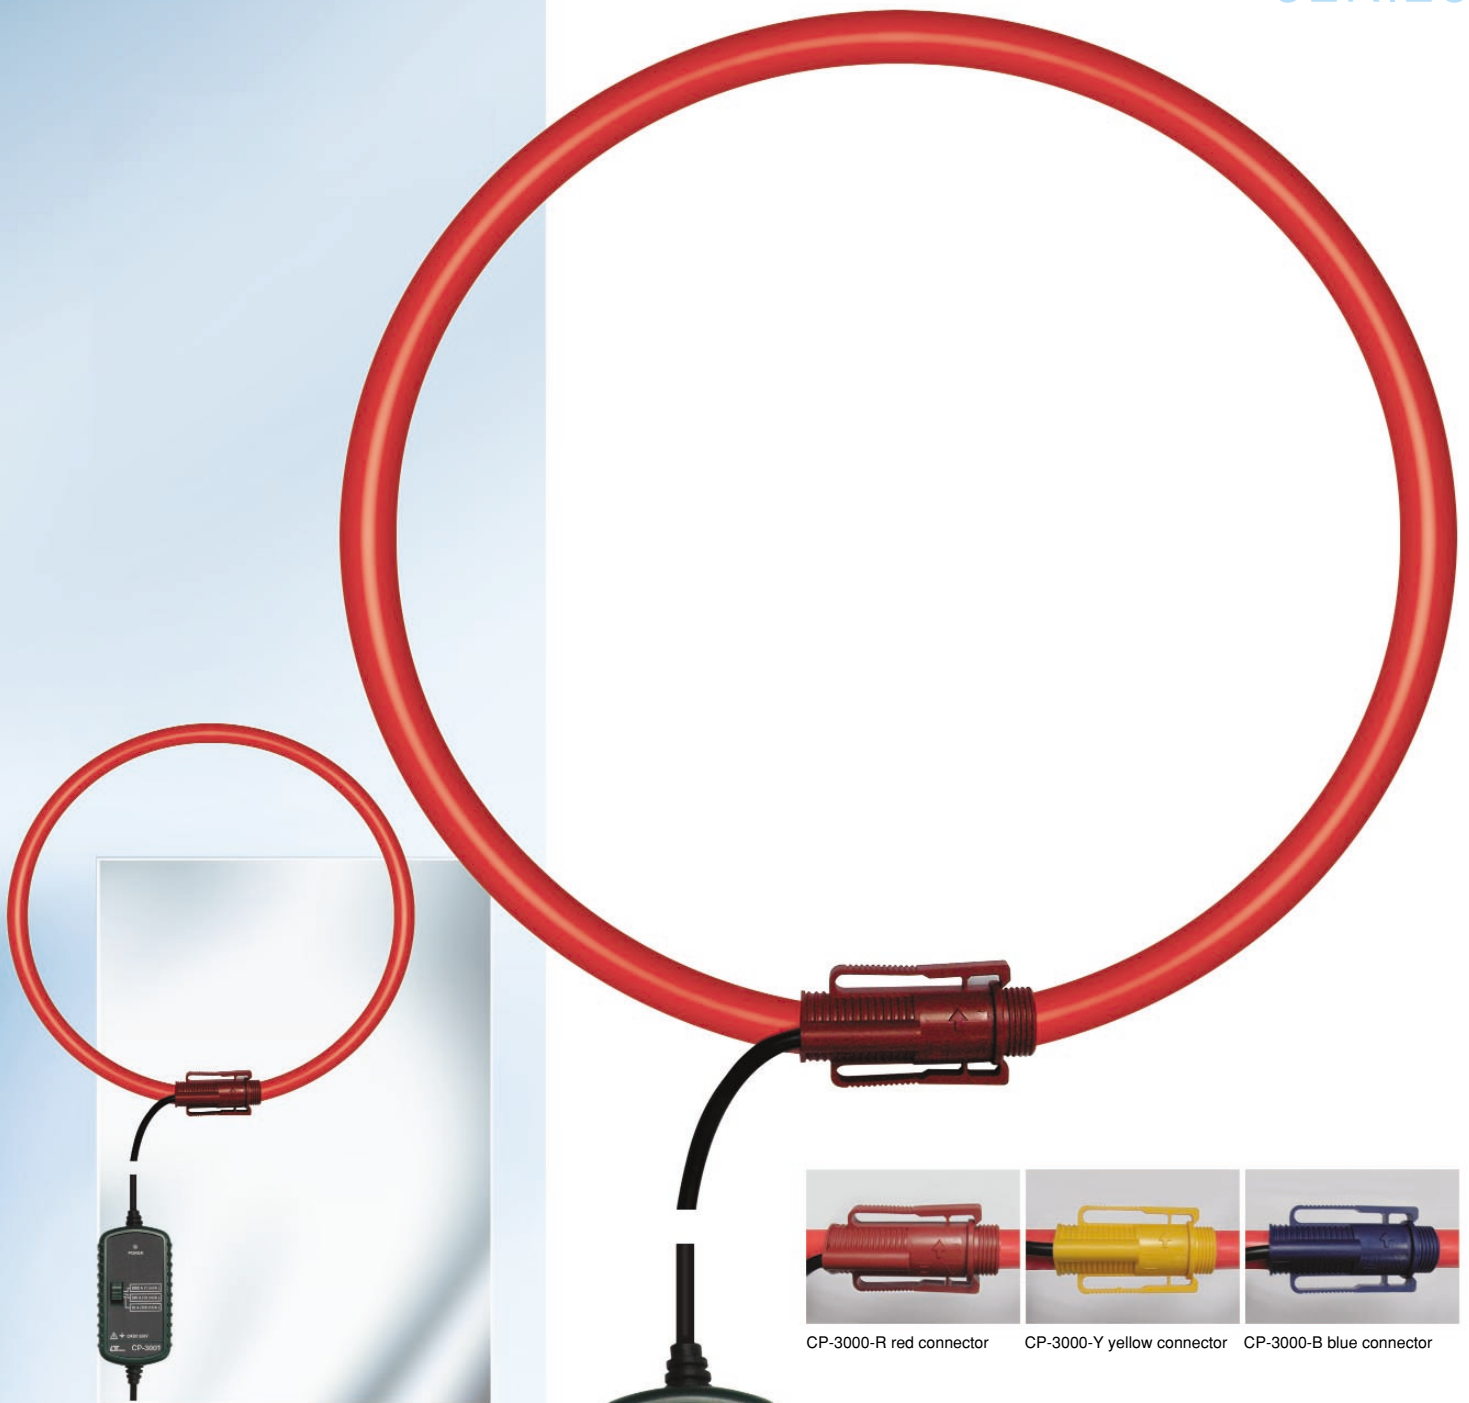

Flexible 3000 Amp current probe

Model : CP-3001-R (red connector)
Model : CP-3001-Y (yellow connector)
Model : CP-3001-B (blue connector)

- * Range : 30 A/300 A/3000 A.
- * Output sensitivity :
100 mV/A, 10 mV/A, 1 mV/A.
- * Output voltage :
3 ACV (30 A, 300 A, 3000 A).
- * Flexible probe length : 600 mm (23.6 inch).
Flexible probe diameter : 15 mm.
- * When changing the new probe, the calibration procedures are not necessary to be executed.
- * Output cable : 2 cables (4 meters in length), use the banana plugs, durable and safety.
- * Power supply : DC 1.5V battery (UM-3/AA) x 2 PCs or DC 9V adapter in.
AC to DC 9V adapter is optional.
- * CP-3001 can cooperate any kind DMM (ACmV meters), if those meters are built-in the ACV mV measurement range to be used as the AC 3000 Amps (max.) current meter.



Flexible 3000 Amp current probe

Model : CP-3000-R (red connector)
Model : CP-3000-Y (yellow connector)
Model : CP-3000-B (blue connector)

- * Range : 30 A/300 A/3000 A.
- * Output sensitivity :
100 mV/A, 10 mV/A, 1 mV/A.
- * Output voltage :
3 ACV (30 A, 300 A, 3000 A).
- * Flexible probe length : 600 mm (23.6 inch).
Flexible probe diameter : 15 mm.
- * Optional current probes for DW-6093, DW-6095.
- * When changing the new probe, the calibration procedures are not necessary to be executed.
- * Output cable : 4 meter wire, use the banana plugs, durable and safety.
- * Power supply is from the meter (DW-6093, DW-6095), battery is not necessary.
- * CP-3000R, CP-3000Y, CP-3000B : function is same with one another, but for identification purpose, the connector color is different.